

CAMS, Inc.
14421 Airport Parkway
Clearwater, Florida
33762

August 3, 2009

Pinellas Pilots Association
PO BOX 17838
Clearwater, FL 33762
Attn: Mike Kutz

Dear Mike,

This table summarizes your current invoice activity. Please review this information and let us know if you have any questions.

Invoice Job	N52633
Invoice Number	5642
Invoice Date	08/01/2009
Invoice Due Date	08/01/2009
Invoice Amount	\$3,150.98
Invoice Balance	\$1,650.98

Itemized charges are shown below:

Item	Description	Qty	Rate	Amount	Tax
Annual/100	Annual/100 hour Inspection (Flat Rate)	1	800.00	800.00	Tax
Oil Change	Change oil and filter. Drained oil, R&R oil filter. Serviced engine with 7 qts of 15/50 oil. Cut open oil filter and examined for contaminants, none found. Washed engine and performed an engine run, no leaks noted.	1.5	75.00	112.50	Tax
Labor	Labor -Check mags. Walt said has 30 to 40 split. True check timing. Set LH & RH mags to 25 degree advance.	1.5	75.00	112.50	Tax
Labor	Labor - Disassembled, cleaned, reassembled and replaced points and cam. Timed internal and to engines. Run up, no leaks noted at this time. Ops checks ok.	5	75.00	375.00	Tax
Labor	Labor -Check main tire, and rotate them. Serviced tires.	2	75.00	150.00	Tax
Dress Props	Dressed and painted propeller blades IAW Service manual.	0.3	75.00	22.50	Tax
Labor	Labor -Move fuel strainer cable pull. Lubricate. Matt wants this done.	0	75.00	0.00	Tax

Labor	Labor -Chain on baggage door. Lubed.	0	75.00	0.00	Tax
Labor	Labor -Outbd landing light Inop. Replaced both.	1	75.00	75.00	Tax
Labor	Labor -Fuel tank screws LH side rusty. LH ty down ring rusty. No action.	0	75.00	0.00	Tax
Labor	Labor -Hole in floor, install plug.	0.1	75.00	7.50	Tax
Labor	Labor -ELT (back up ant) portable ant is not attached to ELT body. Attached and reconnected ELT to ELT body.	0.1	75.00	7.50	Tax
avioncs	Repair- Garmin 327 has a wire pulled off elec. connection on back of it and scat hose is disconnected.	0	75.00	0.00	Tax
Labor	Labor -Both brake master cylinders are low. Serviced reservoirs.	0	75.00	0.00	Tax
Labor	Labor -Control yolk chatters when worked through its travel. Lubed.	0	75.00	0.00	Tax
Labor	Labor -Replaced all intake gaskets and installed new lock washers.	1.3	75.00	97.50	Tax
Labor	Labor -Dip stick tube loose. Removed and replaced safty wire and tightened dip stick.	0.2	75.00	15.00	Tax
Labor	Labor -#2 Oil return leaking at case. Inspected and tightened both clamps.	0.1	75.00	7.50	Tax
Labor	Labor -Starter stud loose. Positive side. Inspected and torqued nut.	0.2	75.00	15.00	Tax
Labor	Labor -Muffler support bracket loose on motor mount. Retorqued to 40 ft pds.	0.3	75.00	22.50	Tax
Labor	Labor -Baffle has loose hardware and rivet puller through. LH side. Matt replaced rivet and secured loose hardware. Warranty.	0	75.00	0.00	Tax
Labor	Labor -Cabin door hinge pins. Secured pins.	0.3	75.00	22.50	Tax
Labor	Labor -Pilots side brake master leaking at shaft. R&R cylinder, inspect. R&R master cylinder, installed new o-rings and bled brakes. Ops checks ok.	1.5	75.00	112.50	Tax
Labor	Labor -Trim chain lubed. Annual	0	75.00	0.00	Tax
Labor	Labor -Elevator cable lubed at top of elevator bell crank. Annual.	0	75.00	0.00	Tax
Labor	Labor -Flap lubed, white grease.	0	75.00	0.00	Tax
Labor	Labor -Tach cable leaking oil inside cabin. Advised Mike.	0	75.00	0.00	Tax
Sparkplug	Clean and Gap Spark plugs. Install 4 new ones.Cleaned, gapped and tested sparkplugs. re-installed sparkplugs with new gaskets.	0.7	75.00	52.50	Tax
Labor	Labor -Exhaust clamp was replaced.	0	75.00	0.00	Tax
Labor	Labor -Wheel fairing cracked. No	0	75.00	0.00	Tax

	action.				
Labor	Labor -LH outbd brake lining worn. Replaced linings. OPS checks ok.	0.5	75.00	37.50	Tax
Labor	Labor -Bottom rudder cap holding water, drill hole.	0.1	75.00	7.50	Tax
Labor	Labor -Set down flap limit switch.	0.4	75.00	30.00 0.00	Tax
AD09-24-10	AD09-24-10 Stand by vacuum check. OPS checks OK.	0.1	75.00	7.50	Tax
AD87-20-03r2	AD87-20-03r2, Seat track inspection. C/W AD by visual and dimensional check of L/H and R/H seat rails. No defects noted.	0.4	75.00	30.00	Tax
Labor	Labor -Induction Filter Due. Challenger STC K&N.	0.5	75.00	37.50	Tax
Labor	Labor -Instrument filter. Check log entry, this may have been done.	0	75.00	0.00	Tax
Labor	Labor -Carb service bulletin. W/A	0.3	75.00	22.50	Tax
15w50	15 w 50 Aeroshell (per quart)	9	7.00	63.00	Tax
ORF	Oil Recycling Fee per quart	6	1.00	6.00	Tax
OFRF	Oil filter recycling fee.	1	2.00	2.00	Tax
AA48111	Tempest oil filter 48111	1	28.00	28.00	Tax
66-10500	Brake Linings	2	15.40	30.80	Tax
105-00200	Brake Rivet	4	1.00	4.00	Tax
M674	Spark plug gasket	4	1.00	4.00	Tax
REM38E	Spark plug	4	33.16	132.64	Tax
4596	Bulb	2	29.00	58.00	Tax
Parts	Exhaust clamp	1	36.27	36.27	Tax
71973	Intake gasket	4	2.00	8.00	Tax
08-00902	Air Filter	1	205.54	205.54	Tax
Mineral Spirit	Mineral Spirits, per Gallon	1	9.00	9.00	Tax
MS28775-110	O-ring	1	1.00	1.00	Tax
C156001-0104	Chain Assembly	1	0.00	0.00	Tax
SL12681	Magneto gasket	2	2.00	4.00	Tax
SL62224	Gaskets	2	2.00	4.00	Tax
M3081	Contact Point Kit	2	49.00	98.00	Tax
Shop Fee	Misc. shop supplies,lubricants and hardware .	1	70.587	70.59	Tax

Thank you for choosing CAMS, Inc.. We hope to work with you again in the future.

Sincerely,

Milea Bernhardt
Parts, Billing & AR Mgr.
CAMS, Inc.